



# GREISINGER EN

## **Transmitter for**

humidity temperature

from version V3.2

**Operating Manual** 



### Content

2
2
2
2
3
3
3
4
4 4
4
5
6
6



**GCON** MESSTECHNIK

### GHM Messtechnik GmbH • Standort Greisinger

Hans-Sachs-Str. 26 • D-93128 Regenstauf ☎ +49 (0) 9402 / 9383-0 昌 +49 (0) 9402 / 9383-33 *≣* <u>info@greisinger.de</u>

### 1 Intended use

The device measures the relative humidity and temperature of air or non corrosive / non ionizing gases.

Field of application

- Room climate monitoring
- Monitoring of storage rooms

etc...

The safety instructions (see chapter 3) have to be observed.

The device must not be used for purposes and under conditions for that the device had not been designed. The device must carefully dealt with and has to be used according to the specifications (do not throw, knock, etc.). It has to be protected against dirt.

Do not expose the sensor to aggressive gases (like ammonia) for longer time.

Avoid condensation, as after drying there may remain residues, which may affect the precision negatively. In dusty environment additional protection has to be applied (special protection caps).

### 2 General advice

Read through this document attentively and make yourself familiar to the operation of the device before you use it. Keep this document in a ready-to-hand way in order to be able to look up in the case of doubt.

### **3** Safety instructions

This device has been designed and tested in accordance to the safety regulations for electronic devices. However, its trouble-free operation and reliability cannot be guaranteed unless the standard safety measures and special safety advises given in this manual will be adhered to when using it.

- Trouble-free operation and reliability of the device can only be guaranteed if it is not subjected to any
  other climatic conditions than those stated under "Specification".
  Transporting the device from a cold to a warm environment condensation may result in a failure of the
  function. In such a case make sure the device temperature has adjusted to the ambient temperature
  before trying a new start-up.
- 2. General instructions and safety regulations for electric, light and heavy current plants, including domestic safety regulations (e.g. VDE), have to be observed.
- 3. If device is to be connected to other devices (e.g. via PC) the circuitry has to be designed most carefully. Internal connection in third party devices (e.g. connection GND and earth) may result in not-permissible voltages impairing or destroying the device or another device connected.
- 4. Whenever there may be a risk whatsoever involved in running it, the device has to be switched off immediately and to be marked accordingly to avoid re-starting. Operator safety may be a risk if:
  - there is visible damage to the device
  - the device is not working as specified
  - the device has been stored under unsuitable conditions for a longer time
  - In case of doubt, please return device to manufacturer for repair or maintenance.
- 5. **Warning:** Do not use this product as safety or emergency stop device or in any other application where failure of the product could result in personal injury or material damage. Failure to comply with these instructions could result in death or serious injury and material damage.

### 4 Disposal notes



This device must not be disposed as "residual waste".

To dispose this device, please send it directly to us (adequately stamped).

We will dispose it appropriately and environmentally friendly.

 
### 5 Assignment of elbow-type plug (depending on type)

4-20mA (2-wire connection)


# voltage, not electrically isolated (3-wire connection)

(1 combined elbow type plug for both signals)

#### 1 humidity 2 A Uv 3 temperature Uv




= GND / signal (temperature)

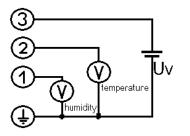

- 1 = signal + (humidity value) 2 = signal + (temperature) 3 = supply voltage +Uv
- $\pm$  (4) = supply voltage -Uv

# voltage, electrically isolated (3- resp. 4-wire connection)

(2 elbow type plugs: right plug is for humidity value\*, left plug is for temperature)

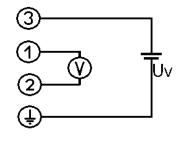

1 = signal + (humidity value or temp.) 2 = signal - (humidity value or temp.) 3 = supply voltage +Uv  $\frac{1}{2} (4) = supply voltage -Uv$ (note:  $\frac{1}{2}$  and 2 are connected internally)


The type "current-" or "voltage output" is set by works and cannot be changed.

ATTENTION: If the humidity circuit is not supplied, the temperature output won't give a valid signal!

### 6 General installation instructions:

To mount the connection cable (2-, 3-, or 4-wire depending on type of device) the elbow-type plug screw has to be loosened and the coupling insert has to be removed by means of a screw driver at the position indicated (arrow).

Pull out connection cable through PG gland and connect to the loose coupling insert as described in the wiring diagram. Replace loose coupling insert onto the pins at the transducer housing and turn cover cap with PG gland in the direction desired till it snaps on (4 different starting positions at 90° intervals). Re-tighten the screw at the angle plug.

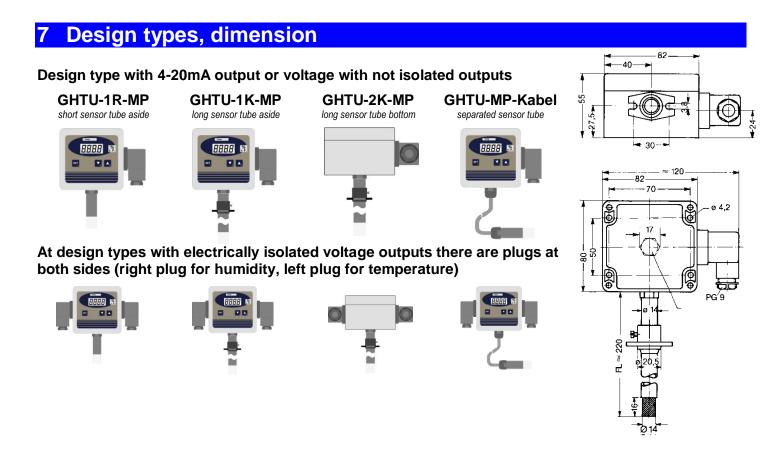

## 8 Display Functions

### 8.1 Measuring display

During normal operation the **relative air humidity** in **[%]** is displayed alternating to the **temperature** in **[°C]** or **[°F]** 



display of relative air humidity

### 8.2 Min/Max Value Memory

watch Min values (Lo):press ▼ shortly oncewatch Max values (Hi):press ▲ shortly oncerestore current values:press ▼ or ▲ once againclear Min-values:press ▼ for 2 secondsclear Max-values:press ▲ for 2 seconds



Arrow to "Temp" indicates temperature display

display temperature

display changes between 'Lo' and Min values display changes between 'Hi' and Max values current values are displayed Min values are cleared. Display shows shortly 'CLr'. Max values are cleared. Display shows shortly 'CLr'.

After 10 seconds the currently measured values will be displayed again.


9 Error and system messages				
Display	Description	Possible fault cause	Remedy	
Err.1	Measuring range exceeded	Wrong signal	Temperature above 120°C not allowed.	
Err.2	Measuring value below measuring range	Wrong signal	Temperature below -40°C not allowed.	
Err.3	Display range has been exceeded	Value >9999	Check settings	
Err.7	System fault	Error in device	Disconnect from supply and reconnect. If error remains: return to manufacturer	
Err.9	Sensor error	Sensor or cable defective	Check sensors, cable and connections, damages visible?	
Er.11	Calculation not possible	Calculation variable missing or invalid	Check temperature	
8.8.8.8	Segment test	The transducer performs a display test for 2 seconds after power up. After that it will change to the display of the measuring.		

#### Operating Manual GHTU ... MP

10 Configuration of the device

Follow these instructions to configure the functions of the device:

- Press **SET** until the first parameter Unit appears in the display
- If a parameter should be changed, press ▼ or ▲,
   The device changed to the setting edit with ▼ or ▲
- Confirm the value with SET
- Jump to the next parameter with SET.

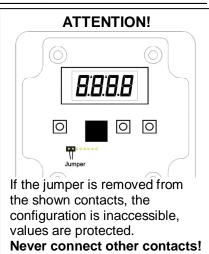

Parameter	value information values are protected.		· · ·	
			Never connect other contacts!	
SET	▼ and ▲			
		e displays factory setting: °C		
Unit	°C	Temperatures in °Celsius		
+ Temp arrow	°F	Temperatures in °Fahrenheit		
	Display at zero out	put of humidity display value (output	•	
Out.0	-xxx.0 +xxx.0	Entry of display value at which the hum (or 0V) (factory setting: 0.0)	idity output should deliver 4 mA	
	Display at maximu	m output for humidity display value (c	output scaling)	
0u£.(	-xxx.0 +xxx.0	Entry of display value at which the hum 20 mA (or 1 V / 10 V) <i>(factory setting:</i>	100.0)	
	Display at zero out	put of temperature display value (out	put scaling)	
+ Temp arrow	-xxx.0 +xxx.0	Entry of display value at which the temp 4mA (or 0V) <i>(factory setting: 0.0)</i>	perature output should deliver	
	Display at maximum output for temperature display value (output scaling)			
+ Temp arrow	-xxx.0 +xxx.0	Entry of display value at which the temp 20 mA (or 1 V / 10 V) (factory setting: 2		
OFFS	Offset correction o	f humidity measuring *)		
	oFF	deactivated (factory setting)		
	-5.0 +5.0	Selectable from -5.0 to +5.0 % rel. hum	idity	
SCRL		humidity measuring *)		
	oFF	deactivated (factory setting)		
	-15.00 +15.00	Selectable from -15.00 to +15.00 % sca	ale correction	
OFFS		f temperature measuring *)		
	oFF	deactivated (factory setting)		
+ Temp arrow	-2.0 +2.0	Selectable from -2.0 to +2.0 °C (or -3,6 to +3.6 °F)		
SCRL		temperature measuring *)		
+ Temp arrow	oFF	deactivated (factory setting)		
	-5.00 +5.00	Selectable from -5.00 to +5.00 % scale	correction	

Pressing SET again stores the settings, the instruments restarts (segment test)

Please note: If there is no key pressed within the menu mode within 2 minutes, the configuration will be cancelled, the entered settings are lost!

\*) if higher values are needed, please check sensor, if necessary return to manufacturer for inspection. Calculation: corrected value = (measured value – Offset) \* (1+Scale/100)

### **11 Notes to the calibration services**

Calibration certificates - DKD-certificates - other certificates:

If device should be certificated for its accuracy, it is the best solution to return it with the referring sensors to the manufacturer. (please state desired test values, e.g. 70 %RH)

Only the manufacturer is capable to do efficient recalibration if necessary to get results of highest accuracy! Humidity transmitters are subject to ageing. For optimum measuring precision we recommend a regular adjusting at the manufacturer (e.g. every 2<sup>nd</sup> year). Cleaning and checking of the sensors is part of the service.

### **12 Specification**

Meas. range humidity	0.0 100.0 %RH		
Recommended humidity measuring range	Standard:20.0 80.0 %RHWorking range of humidity sensor:Option "high humidity":5.0 95.0 %RH100		
Meas. range temperature	-40.0 120.0 °C or -40.0 248.0 °F 80		
Accuracy Display	(at nom. temperature 25°C) Rel. Air humidity: ±2.5 %RH (within recom- mended measuring range)		
Add. Output signal	± 0.2% FS		
Media	Non corrosive gasses		
Sensor	capacitive polymer humidity sensor and Pt1000 °C		
Temperature compensation	automatic		
Meas. frequency	1 per second		
Adjusting	Digital offset and scale adjustment for humidity and temperature		
Min-/Max-value memory	Min and max measured values are stored		
Output signals	refer to type plate,		
Scaling	both freely scalable by entering display values for 4mA (resp. 0V) and 20mA (resp.		
	1V/10V) output		
Connection	4 - 20 mA (2-wire) – output signals are electrically isolated from each other		
For option AV01, AV10	0 - 1 (10) V (3-wire) – output signals are not electrically isolated from each other		
For option AV01G, AV10G	0 - 1 (10) V (3- / 4-wire) – output signals electrically isolated from each other		
Auxiliary energy:	4 - 20  mA: Uv = 12 - 30 V DC		
(supply voltage, each output)	0-1V: $Uv = 12 - 30 V DC$ , max. 10mA		
Perm. impedance	0-10V: $Uv = 18 - 30 V DC$ , max. 10mA 4 - 20 mA: $R_A(Ohm) < ((Uv - 12V) / 0,02A)$		
Ferm. Impedance			
	example: for Uv = 18V: $R_A < (18V - 12V) / 0.02A \implies R_A < 300 \text{ Ohm}$		
Permissible load	0 - 1 (10) V: R <sub>L</sub> (Ohm) > 3000 Ohm		
Display	approx. 10 mm high, 4-digit LCD-display		
Operating elements	3 keys		
Ambient conditions			
Nom. temperature	25°C		
Operating temperature	Electronics: -25 50 °C, sensor head and shaft: -40 100 °C, short time 120 °C		
<b>Bolotivo humiditu</b>	for Option "SHUT": sensor head max. 80 °C		
Relative humidity Storage temperature	Electronics: 0 95 %RH (not condensing)		
Housing	-25 70 °C ABS (IP65, except sensor head)		
Dimensions			
Dimensions	82 x 80 x 55 mm (without elbow-type plug and sensor tube) for Option "Kabel": Sensor head Ø14mm*68mm, 1m teflon cable, high humidity sensor		
Mounting	Holes for wall mounting (in housing - accessible after cover has been removed).		
Mounting distance	50 x 70 mm, max. shaft diameter of mounting screws is 4 mm		
Electrical connection	Elbow-type plug conforming to DIN 43650 (IP65),		
	max. wire cross section: 1.5 mm <sup>2</sup> , wire/cable diameter from 4.5 to 7 mm		
EMC	The device corresponds to the essential protection ratings established in the		
	Regulations of the Council for the Approximation of Legislation for the member		
	countries regarding electromagnetic compatibility (2004/108/EG).		
	In accordance with EN 61326-1: 2006, additional errors: <1 % FS. When connecting		
	long leads adequate measures against voltage surges have to be taken.		